

8"-16" Taper/Scarf Tool Operating Instructions

Introduction

This tool is utilized for tapering or scarfing 8"-16" Red Thread®, Green Thread®, Silver Streak® and Marine Offshore pipe. Please read the operating instructions thoroughly before using this tool.

Taper - For 8"-16" Green Thread, Red Thread and Silver Streak BxS products, machine 1° angle on the pipe spigot end. For 14"-16" Green Thread MOS, machine 1¼° on pipe spigot.

Scarf - For 8"-12" Green Thread MOS and Red Thread/Green Thread Secondary Containment pipe, machine 0° straight cut on the O.D. of pipe end.

Materials Needed:

1. 115 volt power source
2. Sturdy work bench or ridged pipe vise and stands
3. Tie down straps or come-longs to secure pipe
4. O.D. tape
5. Allen wrench set, adjustable end wrench

Counterbalance Installation:


The tool is shipped with a counterbalance block that needs to be bolted to the tool. Locate the four bolt holes on the tool body opposite the cutting head. Mount the counterbalance and secure the bolts tightly before tool is used.

Procedure For Use:


Be sure the tool is unplugged when setting up, working on, or removing the tool from the pipe. When the tool is in operation, a protective barrier around the tool should be utilized.

Tool Set Up:


1. Secure pipe with a factory taper to a sturdy work table or heavy duty pipe stand with tie down straps.

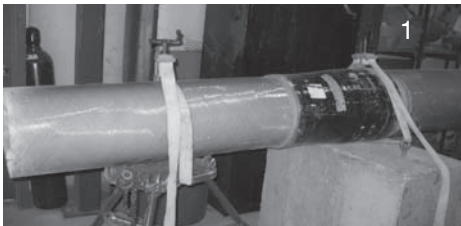


2. Place mandrels on the mandrel shaft with a spacer between each mandrel. Spin the nut up but do not tighten.

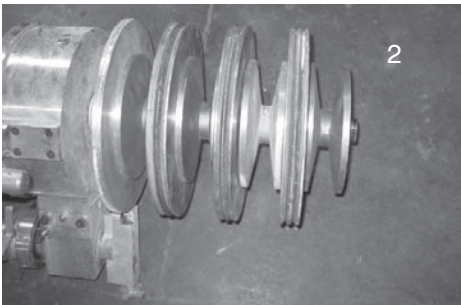


3. Insert tool into pipe with a factory taper or scarf and tighten mandrels using an adjustable end wrench on the mandrel shaft nut.

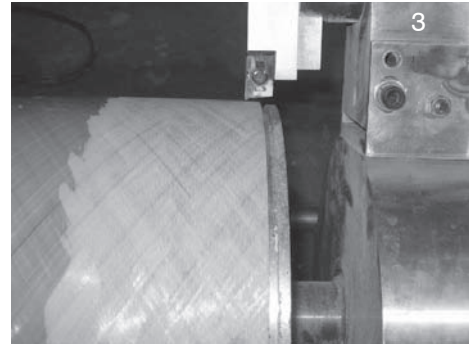

4. Tool head must be set to the appropriate size.
 - a. Loosen two set screws at the top of the cutting head holder and the two thumb screws at the bottom. Remove cutting head.

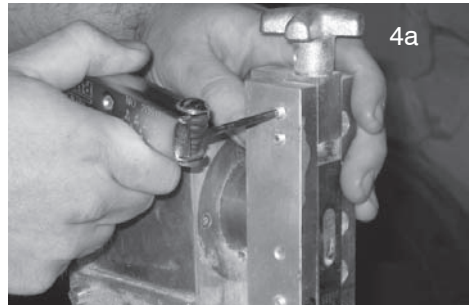

- b. Loosen Allen head bolt and remove the cutting head holders
- c. Place the bolt through the hole on the cutting head holder designated for the size pipe you wish to taper or scarf. Retighten the bolt.

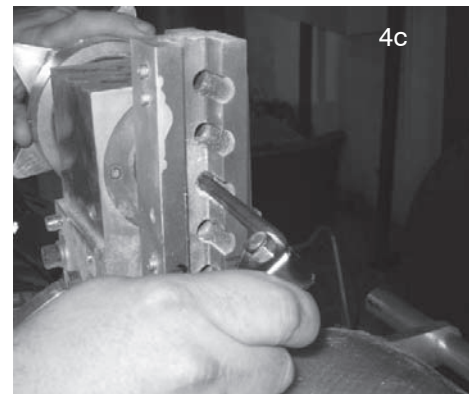

- d. Place cutting head back in the cutting head holder flush with the top and tighten the two screws.


www.fgspipe.com

2700 West 65th Street
Little Rock, Arkansas 72209
Phone: 1 (501) 568-4010

2425 SW 36th Street
San Antonio, Texas 78237
1 (210) 434-5043

NOV Fiber Glass Systems



5. Make sure tool is set for proper angle for the product being installed: 1° for bell x spigot tapered joints, 1¼° for Green Thread MOS BXS joints, and 0° for straight socket or secondary containment joints. To change setting, loosen four Allen head screws center block. Pull pin and place in the appropriate hole.

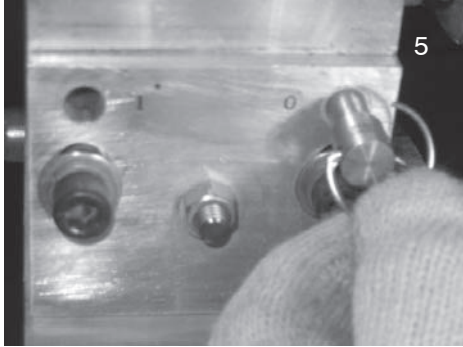


Setting the Depth of Cut

Tool must be inserted into a factory taper or scarf. If a factory scarf or taper is not available, proceed to Step 9.

6. Loosen thumb screws at the bottom of the cutting head. Turn the cutting head knob until the cutting head insert makes light contact with the factory taper or scarf. Tighten bottom thumb screws to lock in cutting depth.

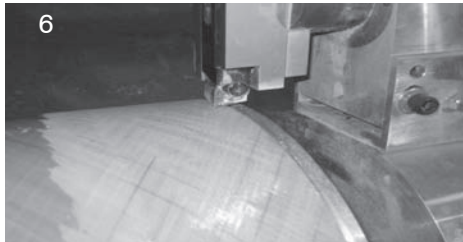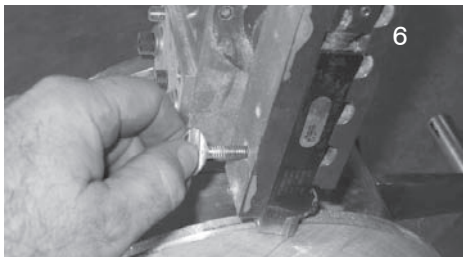

7. With a fine point, permanent marker, place a mark on the cutting head to mark the depth to taper or scarf the pipe. This will be your depth mark in the event the pipe has to be double cut.

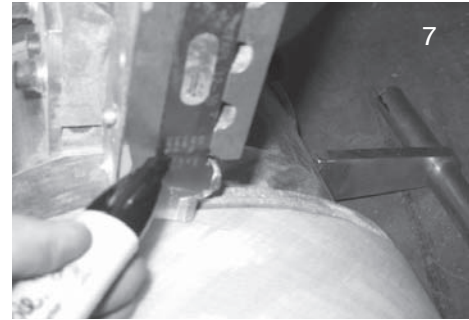


8. For standard 8"-16" Red Thread and Green Thread, proceed to Step 9. Marine Offshore and Performance Plus products may require a "double cut" due to the thickness of the wall. Loosen the bottom thumb screws and raise the cutting head up to where it will cut a maximum of 1/8" off the wall. Once first cut is complete, reset cutting head to depth mark made in Step 7.


Tapering and Scarfing Plain End Pipe

9. Place tool into pipe to be tapered or scarfed and tighten mandrels.

10. Using the star on the cutting head tube, move cutting head horizontally where it is sitting next to the **longest** edge of the pipe but **"not"** touching it.

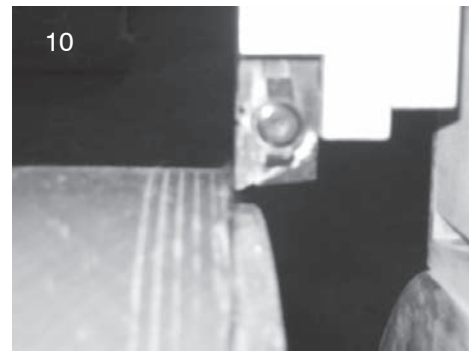

11. a. Attach the motor to the tool by inserting the four cam bolts through the four adjoining holes and aligning the locking pin with the receiving hole.

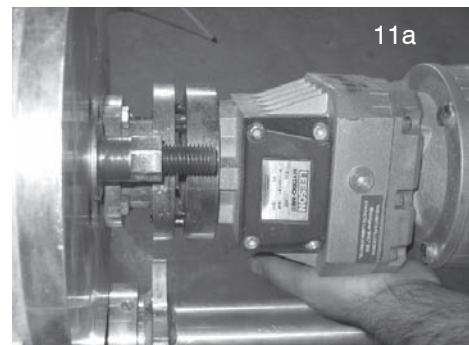

- b. Twist motor to the right and release locking pin to lock in the motor. Be sure that the on/off switch on the control box is in the off position and that no one is standing next to the tool.




- c. Connect a cable between the tool and the control box and then connect the power cable from the control box to a 115 volt power source.



Warning: Be sure the control box is located a minimum of 10 feet away from the pipe and the tool. Keep all personnel a minimum of 10 feet away from tool while running. Unplug the control box from the power source before approaching tool.

12. If tool is set to the factory dimensions (Steps 6-8), you are ready to begin tapering or scarfing the pipe. From the zero position, slowly increase the speed to 3 until the cutter is making 360 degrees of contact with the pipe. If the pipe is not cut square and the speed is too high, the cutting head may “dig in” and cause an overload on the tool or cause the mandrels inside the pipe to spin. When the cutter is making 360 degrees contact, you may turn speed up to a comfortable level.

13. Taper or scarf pipe until cutting head is no longer cutting. Use a reversible drill on back of cutting head shaft to back out cutting head.

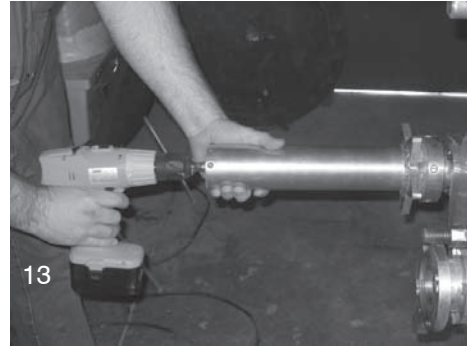

14. For “thicker” wall products, loosen thumb screws and adjust cutting head down to depth mark made in (Step 7). Repeat this step until proper insertion depth is reached (Step 16) or scarf dimension (Tables 1 or 2) is achieved.

15. If chatter or “feathering” appears on the machined surface, the pipe must be cut, retaper, and slow the machine down on the final cut. If chatter or feathering remains, rotate the cutting insert to a fresh side. If the taper or scarf is feathered, thoroughly sand the machined surface to remove loose fibers. For scarfed ends, the back edge of the machined area will require a thorough sanding as well, to remove the rough edges from the scarfing operation.

16. For tapered spigots, check end dimension with a loose coupling or flange. Insertions should be $\pm 1/4$ ”, the insertion length of a factory spigot. If no factory spigot is available, refer to **Manual F6000** for dry insertion lengths.

17. For scarfed pipe, measure the scarfed OD with an OD or diameter tape. Refer to either Table 1 or Table 2 for the appropriate scarfing dimension.



Note: If too large load is received on the motor, the motor control will shut down. If this happens, shut the power off and unplug the tool. Wait 30 seconds and turn on the power. If the motor will not start, shut the power off and unplug the tool. Open the control box and check to see if the breaker has been tripped. If the motor doesn't start after the above actions are taken, contact NOV Fiber Glass Systems at 501-568-4010, ext. 2243.

Table 1 - Scarfing Dimensions for Secondary Containment

Containment Pipe size (In)	Scarf Diameter Using Diameter Tape ($\pm .020''$) (In)	Scarf Circumference Using Standard Tape Measure ($\pm 1/16''$) (In)	Scarf Length (In)
8	8.570	26 ¹⁵ / ₁₆	4
10	10.570	33 ³ / ₁₆	5
12	12.550	39 ⁷ / ₁₆	5
14	14.410	45 ¹ / ₄	5
16	16.410	51 ⁹ / ₁₆	5

Note: Maximum taper over entire scarfed area cannot exceed 0.030".

Table 2 - Scarfing Dimensions for GREEN THREAD® 175/250 Marine-Offshore Piping

Pipe Size		Scarf Diameter Using Diameter Tape		Scarf Circumference Using Standard Tape Measure		Scarf Length		Scarf Length for Flanges	
In	mm	In	mm	In	mm	In	mm	In	mm
8	200	8.740 - 8.750	222.0 - 222.3	27 ¹⁵ / ₃₂ - 27 ¹ / ₂	697.7 - 698.5	3 ¹ / ₄	83	3 ¹ / ₄	83
10	250	10.820 - 10.830	274.8 - 275.1	34 - 34 ¹ / ₃₂	863.6 - 864.4	4 ¹ / ₄	108	3 ¹ / ₂	89
12	300	12.840 - 12.850	326.1 - 326.4	40 ¹¹ / ₃₂ - 40 ³ / ₈	1024.7 - 1025.5	4 ¹ / ₄	108	3 ¹ / ₂	89



National Oilwell Varco has produced this brochure for general information only, and it is not intended for design purposes. Although every effort has been made to maintain the accuracy and reliability of its contents, National Oilwell Varco in no way assumes responsibility for liability for any loss, damage or injury resulting from the use of information and data herein nor is any warranty expressed or implied. Always cross-reference the bulletin date with the most current version listed at the web site noted in this literature.

www.fgspipe.com

2700 West 65th Street
 Little Rock, Arkansas 72209
 Phone: 1 (501) 568-4010

2425 SW 36th Street
 San Antonio, Texas 78237
 1 (210) 434-5043

NOV Fiber Glass Systems

©2009, NATIONAL OILWELL VARCO
 ®Trademark of NATIONAL OILWELL VARCO
 F6622 February 2009